


Wide Spectrum Power Meter for Comprehensive Device Assessment

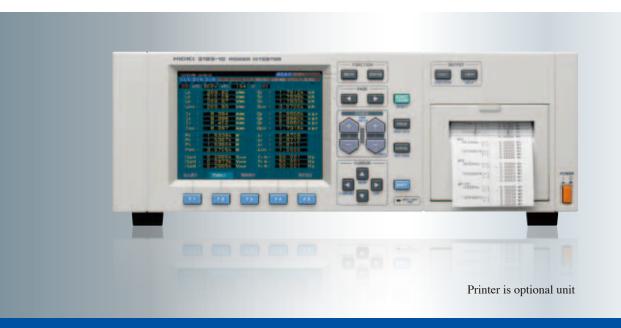

DC/0.5Hz to 1MHz broad-band POWER HiTESTER measures up to 6 systems simultaneously.

The POWER HiTESTER 3193-10 is a multi-function power meter for use with single phase power lines to 3-phase, 4-wire circuits. Accommodating up to 6 units, it is not only capable of measuring up to 6 single phase systems, but can simultaneously measure the input and output of a 3-phase inverter and provide effective power measurements. Additionally, it supports harmonic analysis and flicker measurement (optional), features which are essential for overall device assessment. Standard features include a GP-IB and RS-232C interface, making it easy to feed data to a personal computer for processing and analysis. This unit is ideal for those requiring greater efficiency in electrical device assessment.


AC/DC CURRENT SENSOR



- Rated at 1000A rms
- Wide bandwidth
- Super high precision

Broad coverage, high accuracy, and well-developed interface

Complete with functions that answer all your power measurement needs.

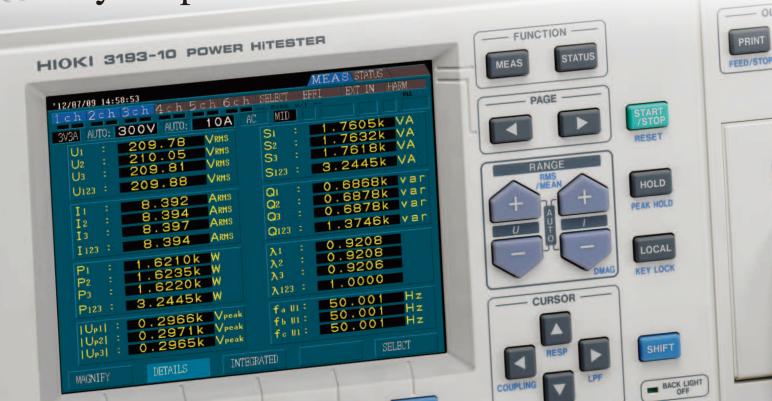

Features

■ Wide range of measurement functions

Capable of measuring voltage, current, active /reactive /apparent power, power factor, phase, frequency, and current, and of integrating power according to polarity, the 3193-10 also provides wave peak and efficiency measurements that are essential to device assessment.

Measure Motor Output

With the optional EXTERNAL SIGNAL INPUT UNIT 9603, the HITESTER can take analog input in from torque and revolution measurements and use that information to calculate motor output.

■ Measurement for Minute Stand-by Power also Available

(by special-order

The 9600 and 9601 input units have 10-times improved current sensitivity, and currents starting from the 20.000mA range can be measured. (Please inquire for further information.)

■ High Visibility Color LCD

Featuring a wide viewing angle, the color LCD displays a variety of items simultaneously, making it ideal for quickly grasping power usage on the system being measured. Expanded display is possible for any four selected items.

Enlarged Indication							
U 123:	201.82 VRIS						
I 123:	9.501 Arus						
P 123:	1.3683 W						
λ 123:	0.7133						

■ Harmonic and Flicker Analysis

Harmonic and flicker analysis are possible when using the optional HARMONIC / FLICKER MEASUREMENTS UNIT 9605.

■ High Basic Accuracy of ±0.2%

Measurements of even greater precision can be obtained using the optional 9600 to 9602 input unit, which provides a basic accuracy of $\pm 0.1\%$ rdg, $\pm 0.1\%$ f.s. (With the 9602, the accuracy of the clamp-on sensor is a factor affecting total accuracy during power measurement.)

A Variety of Interfaces for Differing Needs

★ Connecting to a PC

The RS-232C and GP-IB interface, provided as standard features, make it possible to connect the power meter directly to a PC, allowing efficient measurement, management and analysis of data.



★ Connecting to a Recorder

With 8 selectable D/A outputs and voltage, current and power analog/monitor output (current and voltage only) as standard features, the HiTESTER allows recording of changes and transient fluctuations in waveforms using a recording unit.



★ Connecting to a Printer

Data can be output to the optional PRINTER UNIT 9604.



Print type
Paper width
Main functions

- : Thermal line dot printing
 - : 72mm
 - : printing of items measured, hard copy output of displayed screens, printout of meter settings, printout of various times (such as interval time, timer time, and realtime control time). Printouts are performed either automatically, upon input of an external control signal, or synchronized with an integrator.

DC/0.5Hz to 1MHz broad-band POWER HiTESTER measures up to 6 systems simultaneously.



■ Choose from a variety of input units according to application

Three types of input units are available, including the 9602 AC/DC Clamp Input Unit, which can be used with current levels exceeding 50A under live circuit conditions, as well as the 9600 and 9601 which accept direct input of up to 1000V/50A.

- 9600 · · · DC/0.5Hz to 1MHz wide band
- 9601 · · · 5Hz to 100kHz, for AC only
- 9602 · · · DC/0.5Hz to 200kHz clamp input

Choose from a variety sensors including AC Clamp On Sensors 9272-10 and 9290-10, AC/DC CURRENT PROBEs CT6841, CT6843 and 9279, and super high-precision AC/DC Sensors CT6865, 9709, CT6862 and CT6863.


Feed-through current sensors									
CT6865	9709	CT6863	CT6862						
AC/DC 1000A	AC/DC 500A	AC/DC 200A	AC/DC 50A						


1ch	2ch	3ch	4ch	5ch	6ch
1 ø2 W	1 ø 2W	1 ø 2W	1 ø 2W	1 ø 2W	1 ø 2W
1 ø 3W	/ 3 ø 3W	1 ø 2W	1 ø 2W	1 ø 2W	1 ø 2W
1 ø 3W	/ 3 ø 3W	1 ø 3W	/ 3 ø 3W	1 ø 2W	1 ø 2W
1 ø 3W / 3 ø 3W 1 ø 3W /			/ 3 ø 3W	1 ø 3W	/ 3 ø 3W
3V3A	(3 ø 3W) / 3	ø 4W	1 ø 2W	1 ø 2W	1 ø 2W
3V3A	(3 ø 3W) / 3	ø 4W	1 ø 3W / 3 ø 3W		
3V3A	(3 ø 3W) / 3	ø 4W	3V3A (3 ø 3W) / 3 ø 4W		




■ Simultaneous Measurement of Multiple Systems

Since all units are mutually isolated, the primary and secondary sides of devices or disparate power lines can be measured simultaneously. Simultaneous measurement of single phase 6 wire or 3 phase 2 wire systems which previously required multiple units, can now be handled with one. What's more, measurements of all devices can be taken at the same instant, providing a powerful tool for integrated, all-round device assessment.

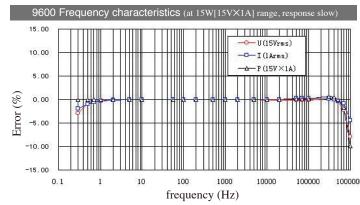

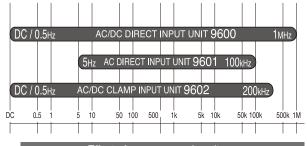

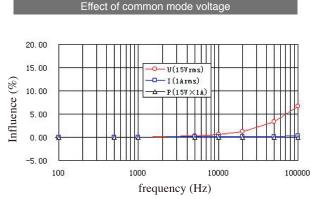


Measure all items at same point in time


The Power Analysis Station

■ Applications of 3193-10

Example of Application With Power Converter

Measure mixed AC and DC components with a single unit.

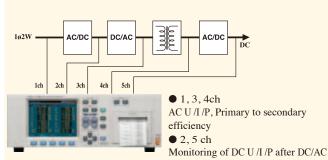

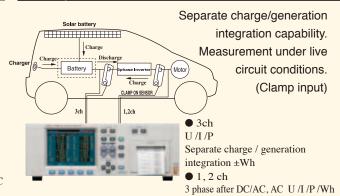


Example of Assessment Trial of EV (Electric Vehicle)

Even Supports Harmonic / Flicker analysis when using the optional 9605 HARMONIC / FLICKER MEASUREMENTS UNIT

Graph Display of Harmonics

Voltage, current and power can be analyzed and displayed by bargraphs of harmonic amplitude, content and phase angle. Voltage, current and power can be displayed simultaneously for a single channel, or a single parameter can be displayed simultaneously for each of three channels.

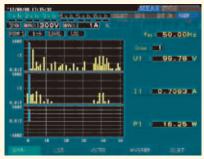

List Display of Harmonics

The harmonic list display shows the amplitude, pro-portion, phase angle and distortion for each harmonic of voltage, current and power. Displaying only proportion, or two parameters simultaneously, such as amplitude and phase angle, is selectable.




Flicker Measurement Display

Displays data during measurement in real-time. Display can also be switched to D measurement and "Pst" value.



Waveform Display

The waveform display shows one cycle of the voltage and current waveforms. RMS and peak values can be displayed along with voltage and current waveforms, or voltage and current waveforms for up to three channels can be displayed at the same time.

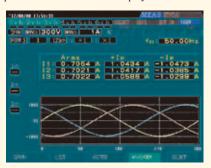


Vector Display of Harmonics

The harmonic vector display shows the voltage, current and phase angle for each harmonic, making clear the voltage-current phase relationship.



Monitor Display

The relative "d" voltage change $\Delta V/V$ and the instantaneous flicker value "S(t)" can be displayed in a time series, so past variations are clearly displayed.

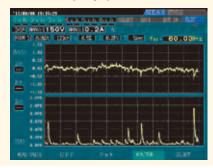

9605 Specifications (optional)

Installation Installs in the 3193-10 main unit

Measurement lines Single-phase 2- and 3-wire, three-phase 4-wire No. of channels : Up to 3 channels within channels 1 to 6, depending

on 3193-10 wiring mode

Output functions : RS-232C, GP-IB, printer

Harmonic Waveform Analysis Functions

Measurement range: Fundamental frequency: 1 to 440 Hz

PLL system (5 to 440 Hz), external clock system (1 to 5 Hz)

Orders analyzed Up to 50th harmonic (with 1 to 250 Hz fundamental) Window width 16 cycles (for 40 to 70 Hz fundamental)

Windowing type Rectangular tiling (no gap between or overlap of windows)

Amount of data analyzed 512 points (for 40 to 70 Hz fundamental) Crest factor Up to 4 (current), and up to 3 (voltage)

Measurement items Harmonic level, percentage and phase angle of each order

of harmonic wave for each of voltage, current and power. Total up to 50th harmonic (of 40 to 70 Hz fundamental) for voltage, current and power. Total harmonic distortion for

voltage and current (THD-F and THD-R)

Measurement of voltage, current, active power, peak voltage

and peak current values of the fundamental

Update rate

: Every 1 window (except during communications with other devices)

Screen displays: List, graph, vector and waveform Harmonic levels; at 45 to 66 Hz Accuracy*

Voltage/current: ±0.5%rdg.±0.05% f.s. Active power: ±1.0%rdg.±0.1% f.s.

For 45 to 66-Hz fundamental, effective input is 0.1 to 110%

Flicker Measurement Function

Measurement range: Fundamental frequency; 45 to 66 Hz, PLL synchronization system

Analysis items : dc (relative constant voltage change), d max (max. relative constant voltage change), d(t)500ms (relative voltage change per time), P0.1/ P1s/ P3s/ P10s and 30s (cumulative probability), Pst (short-term flicker

value). Plt (long-term flicker value)

Screen displays: Measured value, CPF, Pst list, Monitor Accuracy'


: RMS voltage ±0.5%rdg.±0.05%f.s. (45Hz~66Hz)

* The reading accuracy of the input unit must combined with the analysis accuracy shown above. When used with a clamp sensor, accuracy and frequency characteristics of the clamp must be added to the analysis accuracy above.

Other Analysis Functions


Integration According to Polarity

Positive, negative, and total current and power can be integrated simultaneously for all channels. This makes it possible to grasp the income and outflow of power at a glance.




Peak Measurements Function

Voltage and current wave peaks can be measured. The Peak Hold function can be used to find peak values and effective maximums for motor rush current waves.



Analog and D/A Output

Analog (voltage, current, and effective power) and D/ A outputs (any selected eight items) are output as a 5V range full scale value. (Except for the 1000V range), 100ms response time can be obtained by using the FAST setting.

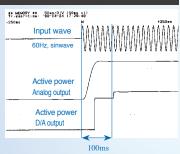

3 Types of Averaging Functions

Select from time average, moving average and exponential average.

3ch Frequency Measurement Function


With the frequency ranges, LPF and HPF can be used in combination, allowing measurement of fundamental waveforms and carrier waveforms of inverters.

Efficiency Calculation Function

Three efficiency calculations can be obtained simultaneously from measured voltage values.

Wave Monitor Output

With the voltage and current ranges, waveforms are output as 1V full scale values, allowing waveforms to be monitored using devices such as recorders or synchroscopes.

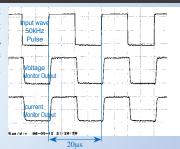

3 Types of Built-in Low Pass Filters

Selectable cutoff frequencies (500/5k/300kHz) allow extraction of the frequency component of fundamental inverter waveforms and provide data compatibility with previous instruments.

Choose from Three Types of Calculation Algorithms

Three selectable algorithms are provided for calculating apparent power and reactive power, providing compatibility with previous devices

Multi-Channel Recorders

MEMORY HICORDER MR8847A



The Ideal Recorder for Field Use, Easy Portability and Sturdy Construction

- 20M-Sampling/s
- Max. 16 ch + logic 16 ch
- 32M to 256M-Word Memory (2ch)

MEMORY HICORDER MR8875



Smart Design - Smart Engineering

- 500k-Sampling/s
- Max. 16ch+Logic 8ch
- Memory 8M-word by each input unit, total 32M-words

■ Optional Input Unit Specifications


Customized versions of Models 9600 and 9601 are also available for stand-by power measurement with 10-times improved sensitivity for current ranges. Please ask for detailed specs.


	AC/DC DIRECT INPUT UNIT 9600					AC/DC CLAMP INPUT UNIT 9602		
	Voltage	Cur	rent	Active	power	Voltage	Current	Active power
Measurement	6.0000/15.000/30.000/	200.00/50	00.00mA/	Deper	nds on	6.0000/15.000/30.000/	500.00mA to 1000.0A	Depends on
	60.000/150.00/300.00/	1.0000/2.0	000/5.0000/	combinatio	n of voltage	60.000/150.00/300.00/	(Depends on clamp-on	combination of voltage
range	600.00V/1.0000 kV	10.000/20.0	00/50.000 A	and curre	ent ranges	600.00V	sensor)	and current ranges
Max.operating input (55Hz)	1000Vrms/1500 V peak	65Arms/1	00 A peak			650Vrms/850Vpeak	(Depends on clamp-on sensor)	
Crest factor	Lower of either (measured or maximum permissible r	range X 6) / m ated peak / mea	easured value asured value			Lower of either (measured range X 6)/ measured value or maximum permissible rated peak/measured value		
Input resistance	2MΩ±5%	1mΩ	max.			2MΩ±5%	200kΩ±5%	
Accuracy	(Accuracy assured at 23	8°C±5°C (73°	73°F ±9°F) at 80% R.H., power factor = 1			, sine wave input, in-phas	se voltage 0, after DMAG	
DC	±0.1%rdg.±0.2%f.s.	+	_	<	_	±0.1%rdg.±0.2%f.s.	←	←
0.5 to 1Hz	±0.5%rdg.±0.5%f.s.	+	_	←		±0.5%rdg.±0.5%f.s.	←	←
1 to 10Hz	±0.2%rdg.±0.2%f.s.	+	_	←		±0.2%rdg.±0.2%f.s.	←	←
10 to 45Hz	±0.1%rdg.±0.2%f.s.	+	_	←		±0.1%rdg.±0.2%f.s.	←	←
45 to 66Hz	±0.1%rdg.±0.1%f.s.	+	_	←		±0.1%rdg.±0.1%f.s.	←	←
66Hz to 10kHz	±0.1%rdg.±0.2%f.s.	+	_	←		±0.1%rdg.±0.2%f.s.	←	←
10 k to 50kHz	±0.3%rdg.±0.3%f.s.	+	_	<	_	±0.5%rdg.±0.5%f.s.	←	←
		Less than 5 A	Greater than 5 A	Less than 5 A	Greater than 5 A			
50 k to 100kHz	±0.5%rdg.±0.5%f.s.	±0.5%rdg. ±0.5%f.s.	±2.5%f.s.	±0.5%rdg. ±0.5%f.s.	±5.0%f.s.	±0.5%rdg.±0.5%f.s.	←	±0.3%rdg.±0.5%f.s.
100k to 300kHz	±0.5%rdg.±0.5%f.s.	±0.5%rdg. ±0.5%f.s.	±5%f.s.	±1.0%rdg. ±1.5%f.s.	±10.0%f.s.	$\pm 15\% f.s.$ (up to 200kHz)	←	±30% f.s.(up to 200kHz)
300k to 400kHz	±1.5%rdg.±0.5%f.s.	±1.0%rdg. ±0.5%f.s.		±1.0%rdg. ±2.5%f.s.		■ Compatible Clamp (Optional)		6
400k to 500kHz	±2.0%rdg.±1.0%f.s.	±2.0%rdg. ±1.0%f.s.		±2.0%rdg. ±2.5%f.s.				peor is a factor offecting
500k to 700kHz	±10.0%f.s.	±10.0%f.s.		±15.0%f.s.	With the 9602, the accuracy of the clamp-on sensor is a factor affet total accuracy during current measurement, as are phase and frequency.			
700k to 1 MHz	±15.0%f.s.	±15.0%f.s.				characteristics. See page 8 for details on the clamp-on sensor specifications.		

AC DIRECT INPUT UNIT 9601 Voltage Current Active power 1000V 200.00/500.00mA/ Depends on Measurement ⊊ 900v 60.000/150.00/300.00/6 1.0000/2.0000/5.0000/ combination of voltage 00.00V/1.0000 kV range 10.000/20.000/50.000 A and current ranges Max.operating input (55Hz) 1000Vrms/1500 V peak 65Arms/100 A peak Lower of either (measured range × 6) / measured value or maximum permissible rated peak / measured value Crest factor Input resistance $2M\Omega \pm 5\%$ $1m\Omega$ max. Accuracy (Accuracy assured at 23°C ±5°C(73°F ±9°F) at 80% R.H., power factor = 1, sine wave input, in-phase voltage 0) 5 to 10Hz ±2.5%f.s. 10 to 20Hz ±1.0%f.s. 20 to 45Hz ±0.1%rdg.±0.2%f.s. 45 to 66Hz ±0.1%rdg.±0.1%f.s. 66Hz to 5kHz ±0.1%rdg.±0.2%f.s. 5k to 10kHz ±0.2%rdg.±0.4%f.s. 10k to 20kHz $\pm 1.0\% f.s.$ ±2.5%f.s. 20k to 50kHz 50k to 100kHz ±10.0%f.s.

Assured Accuracy Range for Input Frequency of the 9600

9601 and 9602 each have assured ranges for input frequency.

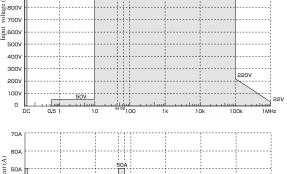

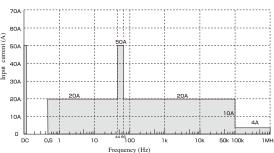

Note 1: Assured accuracy ranges for different response settings are as follows: FAST (0.1 sec) to DC and greater than 50 Hz, MID (0.8 sec) to DC and greater than 10 Hz, SLOW (5.0 sec) to DC or greater than 0.5 Hz

Note 2: Assured accuracy ranges for combined mode measurement are 10 Hz or greater for the AC mode, and DC only for the AC+DC mode or DC mode.

Calculation algorithm (Indicated only for single phase, 2 wire and 3 phase, 3 wire (3V3A). Two additional calculation algorithms can be selected for apparent/reactive power)

		3		•				
		Voltage	Current	Active power	Apparent power	Reactive power	Power factor	Phase
	1ø2W	\mathbf{U}_1	\mathbf{I}_1	\mathbf{P}_{1}	$S_1=U_1\times I_1$	$Q_1=s_1\sqrt{(U_1I_1)^2-P_1^2}$	$\lambda_1 = S_1 P_1 / S_1 $	$\phi_1 = S_1 \cos^{-1} \lambda_1 $
SUN	0,5011	$U_{1\cdot 2\cdot 3} = \frac{U_1 + U_2 + U_3}{3}$	$I_{1\cdot 2\cdot 3} = \frac{I_1 + I_2 + I_3}{3}$	$P_{1\cdot 2\cdot 3}=P_1+P_2$	$S_{1\cdot 2\cdot 3} = \frac{\sqrt{3}}{3}(U_1I_1 + U_2I_2 + U_3I_3)$	$Q_{122} = {s_1 \sqrt{(U_1 I_1)^2 - P_1^2} + s_2 \sqrt{(U_2 I_2)^2 - P_2^2}}$	$\lambda_{1\cdot 2\cdot 3} = su \left \frac{P_{1\cdot 2\cdot 3}}{S_{1\cdot 2\cdot 3}} \right $	$\phi_{1:2:3} = \text{su cos}^{-1} \lambda_{1:2:3} $

Note 1: The above calculation algorithm is for a single phase, 2 wire input to ch 1, and 3 phase, 3 wire input to ch 1/2/3 (3 voltage, 3 current).

Note 2: The "s" before each power factor or phase operation indicates the lead or lag of current phase in relation to voltage. The "-" sign means current phase leads voltage and when there is no symbol, it lags. "su" is "-" when the sum of reactive power is negative and "+" (but unsigned) when it is positive.

■ Basic specifications

Measurement line : Single phase 2 wire, single phase 3 wire, 3 phase 3 wire

(3V3A is possible), 3 phase 4 wire

Measurement item : When using 9600, 9601, 9602 (optional)

Voltage, current, voltage/current peak, effective/reactive/apparent power, power factor, phase, frequency, current/power integration, load rate, efficiency.

When using the 9603 (optional)

Voltage, torque, r/min, frequency, motor output.

When using the 9605 (optional)

Harmonic, waveform, voltage fluctuation / flicker measurement function.

Display indication range : At the lowest range in the DC mode of Models 9600 & 9602: 0.2% to 130% At the lowest range in the AC+DC mode of Models 9600 & 9602: 0.5% to 130%

At the 200mA range of Model 9601: 0.5% to 130%

At 0.1% to 130% of all other ranges

All range is zero suppressed at less than lower % value. Valid input range for voltage, current, and power is 0.5% to 110%

6.4 inch TFT color LCD (640 × 480 dot) Display

99999 count (except with integration), 9999999 count (with integration) Display resolution Switchable between RMS (true root mean square value) and MEAN Rectification method

(average rectified RMS indication). When combined mode DC is

selected, its not possible to switch between them.

8 times/sec. Display update rate Combined mode

DC, AC + DC, AC (AC only when used in combination

with 9601 or 9602 + AC clamp-on sensor)

FAST (0.1 sec.), MID (0.8 sec.), SLOW (5.0 sec.) Analog response time :

(Time required for stabilization to within $\pm 1\%$ when input is changed

from 0% to 90%, or 100% to 10% of range.)

Low pass filter : OFF / 500Hz / 5kHz / 300kHz (-3dB) For 9601, 5k

/ 300kHz not available. OFF / 200Hz (-3dB) Polarity detection regulation filter

Voltage / current / active power Analog output

DC ±5V f.s (1000V range is DC ±3.333 V f.s.)

Monitor output : Voltage / current: 1Vrms f.s. (1000V range is 0.6667 Vrms f.s.)

[Voltage/ Current/ Active power measurement]

Measurement range : See Page 5 specifications for individual input units

[Integration measurement]

Number of measurements : 64 times/sec

 $\label{eq:Measurement range : 0 to ±9999999 TAh / TWh (integration time up to 10,000 hours)} \\$

[Power factor/ Phase angle measurement]

Measurement range : -1.0000 (lead) to 0.0000 to 1.0000 (lag)

-180°(lead) to 0.00° to 180.00°(lag)

[Frequency measurement]

Number of channels : Max. 3ch (selection of voltage or current for arbitrary channel)

Effective input range $\,:\,0.5~Hz$ to 2~MHz

: Auto / 50Hz/ 500Hz / 50 kHz / 2 MHz

[Wave peak measurement]

Measurement items : Select either voltage or current for each unit (Shows absolute value of max.) Effective Input Range : Effective value of sine wave is within effective input permi-

ssible in the range

[Motor output (Pm) measured] 9603 (optional) external input unit required

Measurement method : Digital calculation from measured voltage or pulse signal

Effective when 9603 ch A is torque (any of N/ m, mN/m, kN/m, kgf/m,

kgf/cm), and ch B is r/m

Display indication range : 0.1% to 130% of 9603 voltage range (polarity not indicated)

Calculation algorithm : Set to required format

[Efficiency measurement]

Calculable factors : Maximum of 3 formats

Calculated items : P for each input unit, Pm when combined with 9603

(Items measured with 9605 not allowed)

[D/A output]

Number of channels $\,:\, 8ch \ (12 \ bit \ D/A \ converter \ polarity + 11bit)$

Output impedance : $100\Omega \pm 5\%$

Output items : Outputs 8 arbitrarily selected items

Output voltage : DC±5V/f.s. : 16 times/sec Output update rate

[Interface]

GP-IB : Conforms to IEEE-488.1 1987, with reference to IEEE-488.2 1987 RS-232C : Start-stop synchronous, with baud rate of 2400 or 9600 bits/sec

[External Control]

Functions : Integration start / stop control, Integration data reset, External

A/D (For display update when power meter display is in hold mode),

Manual print control

: From 0 / 5V logic signal or short/open contact signal Control signal level

[Other functions]

Scaling : PT/CT ratio Set range 0.0001 to 99999

Averaging : Time average (set interval time, timer time, and average of

realtime control time)

Moving average (number of samples: 8/16/32/64) Exponential average (attenuation factor: 8/16/32/64)

Multilingual display Japanese/English screen display switching

: Interval control time (10 sec to 100 hours) in 10 sec increments Set time (all types)

(When used in combination with printer, auto select increments) Timer control time (1 min to 10000 hours) in 1 minute increments Realtime control time, 1 minute increments

[Harmonic / Flicker measurement] 9605 (optional) required

Measurement item : See Page 4 specifications for 9605

■ Measurement accuracy (Accuracy guaranteed for 6 months, Post-adjustment accuracy guaranteed for 6 months)

V, A, W : Per accuracy table on page 5

Apparent / reactive ±1 dgt. with respect to calculation from measured value (U, I, P)

power Integration

sum value is max. ±3dgt. ±1dgt with respect to values calculated from measurements (I,P) Power factor Max. ±3dgt with respect to values calculated from measurements (U, I, P) Phase angle Max. ±3dgt with respect to values calculated from measurements (U, I, P)

: ±0.1% rdg. ±1 dgt. (0°C to 40°C(32°F to 104°F), for sine wave Frequency input between 10% to 130% of U/I range)

Wave peak : $\pm 1\%$ (at 0.5Hz to 1kHz), $\pm 2\%$ (at 1kHz to 10kHz), $\pm 10\%$

(at 10kHz to 100kHz)

Motor output : ±1dgt for calculations of each measured value

Efficiency : Max. ±7 dgt with respect to values calculated from measure-

ments of items substituted into algorithm

Within ±0.03% f.s/ °C Thermal coefficient

Effect of in-phase Within ±0.05% f.s

(1000 Vrms, 50/60Hz, between shorted voltage input terminals and case) voltage

Effect of power factor $\pm 0.15\%$ f.s (power factor = 0) Actual time ± 25 ppm ± 1 dgt. (0 to 40°C (73°F to 41°F)) D/A output Display accuracy - ±0.2% f.s Display accuracy - ±0.2% f.s Analog output

Display accuracy - $\pm 0.2\%$ f.s (less than 100kHz) Monitor output

Display accuracy - ±3dB (100k to 1MHz)

■ General Specifications

Maximum rated voltage to earth

Location for use Indoors, altitude to 2000 m, Pollution level 2

Power meter, 0°Cto 40°C (32°F to 104°F), rh below 80% (no condensation) Ambient use humidity

When using printer, 5°C to 40°C (41°F to 104°F), rh below 80% Ambient storage humidity -10°C to 50°C (14°F to 122°F), rh below 80% and no condensation Using with the 9600 and 9601

Voltage input terminal, Current input terminal 600 V measurement category III (expected transient overvoltage: 6000 V) 1000 V measurement category II (expected transient overvoltage: 6000 V)

Using with the 9602 Voltage input terminal

600 V measurement category III (expected transient overvoltage: 6000 V)

Withstand voltage AC5.55kV between U/I terminal and unit case, between U/I (50/60 Hz, 1 minute) terminal and power supply plug (for 9600 and 9601), between U

terminal and clamp input terminal, between U terminal and unit case, between U input terminal and power supply plug (for 9602) Certifications : Safety

EN61010 : EMC EN61326 EN61000-3-2 EN61000-3-3

 $AC100V/120V/200V/230V \ (switched \ automatically), 50/60Hz$ Power supply

150VA max. Maximum rated power

Approx 430 W X150 H X 370 D mm, Approx13 kg Dimensions, mass : (Approx 16.93"(W) 5.91" (H)14.57" (D), Approx 458.6 oz.)

(in configuration including 9600 5 6ch, 9603, 9604) (Not including projections such as terminals, feet, and handles)

: Power cord 1, ground adapter (3P to 2P) 1, Accessories


connector 1

Ordering information

Note: Main unit 3193-10 cannot operate alone - please purchase an input unit Model 9600 to 9605 for factory installation prior to shipment. All subsequent input unit replacements or expansions must be conducted at HIOKI for an additional service charge.

EXTERNAL SIGNAL INPUT UNIT 9603

please purchase an input unit Model 9600, 9601, and 9602

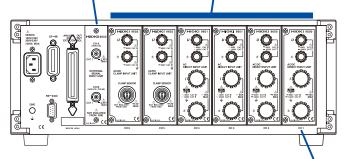

- Use the same input unit for a particular measurement
- Install units in succession starting from channel 1.
- For the 9603 only one unit can be installed.
- When the 9602 is selected, use an optional clamp-on sensor.

1ch



<u> √GP-IB</u>/ /RS-232C/ ϵ

): 9600, 9601, 9602 can be selected.

	1ch	2ch	3ch	4ch	5ch	6ch
Pattern A	1 ø 2W ()	1 ø 2W ()	1 ø 2W ()	1 ø 2W ()	1 ø 2W ()	1 ø 2W ()
Pattern B	1 ø 3W / 3 ø 3	W (×2)	1 ø 2W ()	1 ø 2W ()	1 ø 2W ()	1 ø 2W ()
Pattern C	1 ø 3W / 3 ø 3	W (×2)	1 ø 3W / 3 ø 3	W (×2)	1 ø 2W ()	1 ø 2W ()
Pattern D	1 ø 3W / 3 ø 3	W (×2)	1 ø 3W / 3 ø 3	W (×2)	1 ø 3W / 3 ø 3	W (×2)
Pattern E	3V3A (3 ø	3W) / 3 ø 4W	(x3)	1 ø 2W ()	1 ø 2W ()	1 ø 2W ()
Pattern F	3V3A (3 ø	3W) / 3 ø 4W	(x3)	1 ø 3W / 3 ø 3	W (×2)	1 ø 2W ()
Pattern G	3V3A (3 ø	3W) / 3 ø 4W	(x3)	3V3A (3 ø	3W) / 3 ø 4W	(x3)

Model: POWER HITESTER 3193-10

Model No. (Order Code) (Note)

(Main unit only, no FDD) Accessories: Instruction manual ×1. Power cord ×1 Connector ×1

*Voltage cables are not supplied with the Input Unit 9600 to the 9602. Also, please contact your HIOKI distributor for clip type leads or other special needs.

AC/DC DIRECT AC DIRECT AC/DC CLAMP EXTERNAL SIGNAL PRINTER UNIT INPUT UNIT INPUT UNIT INPUT UNIT **INPUT UNIT 9603** 9604 For the 3193, 3193-10 Data print, screen 9600 9601 9602 only, Pulse, DC voltage 6 V to 1 kV. 200 60 V to 1 kV 200 6 V to 600 V, 500 mA copy, built-in unit to 500 A, * Depends input, 2 channels input type, not CE Marked mA to 50 A mA to 50 A on clamp on sensor in





AC/DC CURRENT SENSOR CT6862 High-precision pull-through type, DC to 1 MHz, 50 A input, ±0.06% amplitude accuracy, ±0.2° phase accuracy, PL23

AC/DC CURRENT SENSOR CT6863 High-precision pull-through type, DC to 500 kHz, 200 A input, ±0.06% amplitude accuracy, ±0.2° phase accuracy, PL23 terminal

AC/DC CURRENT PROBE CT6841 DC to 1 MHz, 20 A input, ±0.31% amplitude accuracy, ±0.1° phase accuracy, PL23 terminal

AC/DC CURRENT PROBE CT6843 DC to 500 kHz, 200 A input, ±0.31% amplitude accuracy, ±0.1° phase accuracy, PL23 terminal

CLAMP ON SENSOR 9272-10 $^{1}\,\rm Hz$ to 100 kHz, 20/200 A switching input, $\pm 0.31\%$ amplitude accuracy, $\pm 0.2^{\circ}$ phase accuracy, PL23 terminal

Up to 500 A (High precision)

AC/DC CURRENT SENSOR 9709 High-precision pull-through type, DC to 100 kHz, 500 A input, ±0.06% amplitude accuracy, ±0.2° phase accuracy, PL23 terminal AC/DC CURRENT PROBE CT6844 DC to 200 kHz, 500 A input, ±0.31% amplitude ac ±0.1° phase accuracy, PL23 terminal

> AC/DC CURRENT PROBE CT6845 DC to 100 kHz, 500 A input, ±0.31% ar ±0.1° phase accuracy, PL23 terminal

- * Model CT6863 is recognized as the UNIVERSAL CLAMP ON CT Model 9278 by Model 3193/3193-10/3194, but operability is supported.
- * In order to use AC/DC CURRENT SENSOR Model CT6862 with Model 3193/3194, a firmware upgrade of Model 3193/3194 is required.

AC/DC CURRENT SENSOR CT6865 High-precision pull-through type, DC to 20 kHz, 1000 A input, ±0.06% amplitude accuracy, ±0.2° phase accuracy, AC/DC CURRENT PROBE CT6846 DC to 20 kHz, 1000 A input, ±0.31% amplitude accuracy. ±0.1° phase accuracy, PL23 terminal

*When using ME15W terminal sensors with the "-05" suffix, the CT9901 is required as a connector adapter. *When using ME15W terminal sensors CT6865-05 and CT6846-05, connection via the CT9901 and manual settings are required on the main device.







GRABBER CLIP 9243 Attaches to the tip of the in) length, CAT III 1000 V



MAGNETIC ADAPTER 9804-01 Attaches to the tip of cord, red ×1, φ11 mm

MAGNETIC ADAPTER 9804-02 Attaches to the tip of cord, black ×1, φ11 mm

HIOKI (Shanghai) SALES & TRADING CO., LTD. TEL +86-21-6391-0090/0092 FAX +86-21-6391-0360

http://www.hioki.cn / E-mail: info@hioki.com.cn

MAGNETIC ADAPTER 9804 Attaches to the tip of the Voltage Cord L9438-50 or other, Red/Black set (each 1)



9637



9638



CABLE 9151-02

Note: Company names and Product names appearing in this catalog are trademarks or registered trademarks of various companies

DISTRIBUTED BY

HIOKI E.E. CORPORATION

HEADQUARTERS

81 Koizumi, Ueda, Nagano 386-1192 Japan TEL +81-268-28-0562 FAX +81-268-28-0568 http://www.hioki.com/ E-mail: os-com@hioki.co.jp

HIOKI SINGAPORE PTE. LTD. TEL +65-6634-7677 FAX +65-6634-7477 E-mail: info-sg@hioki.com.sg HIOKI KOREA CO., LTD.

TEL +82-2-2183-8847 FAX +82-2-2183-3360 E-mail: info-kr@hioki.co.jp

HIOKI USA CORPORATION

TEL +1-609-409-9109 FAX +1-609-409-9108 http://www.hiokiusa.com / E-mail: hioki@hiokiusa.com

HIOKI EUROPE GmbH

TEL +49-6173-3234063 FAX +49-6173-3234064 E-mail: hioki@hioki.eu